

Teralba Quarry Environmental Monitoring Summary

March 2021

Environmental Protection Licence (EPL): 536

Licensee: Metromix Pty Limited

Licensee Address: PO Box 1295

Parramatta, NSW 2124

Premises: Metromix Pty Limited Teralba Quarry

Rhondda Road Teralba, NSW 2284

Licensee Website: https://www.metromix.com.au/

Licensee Website - Monitoring Results: https://www.metromix.com.au/resources/#quarry


EPA Public Register: https://www.epa.nsw.gov.au/licensing-and-regulation/public-registers

Prepared by: R. W. Corkery & Co.

Sample Period:March 2021Data Last Received16 April 2021Date of Report21 April 2021

Contents

- 1 Deposited Dust
- 2 Particulate Matter (PM₁₀)
- 3 Water
- 4 Meteorological Conditions
- 5 Blasting
- 6 Waste

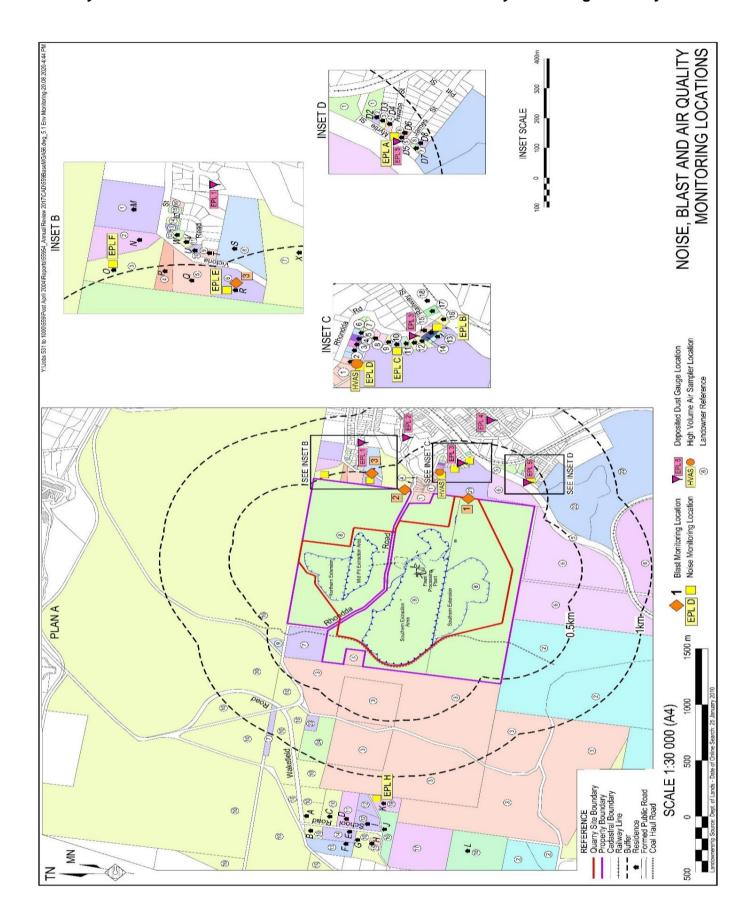

Deposited Dust

EPA Identification No.	Location	Criteria (g/m²/month)	Insoluble Solids (g/m²/month)	Ash Fraction (g/m²/month)	% Ash Fraction
1	Hillside Crescent	4.0	0.8	0.2	25%
8	Rodgers Street	4.0	0.5	0.2	40%
9	Rhondda Road	4.0	0.6	0.2	33%
11	Myrtle Street	4.0	0.5	0.2	40%
23	York Street	4.0	0.9	0.5	56%

Comments

All deposited dust results remained below the approved criteria for the sample period.

Deposited Dust - Year to Date

	Rho	ondda Road		My	rtle Street		Hills	ide Crescent		Roo	lgers Street		Y	ork Street	
	Total			Total			Total			Total			Total		
	Insoluble	Ash		Insoluble	Ash		Insoluble	Ash		Insoluble	Ash		Insoluble	Ash	
	Solids	Fraction	% Ash	Solids	Fraction	% Ash	Solids	Fraction	% Ash	Solids	Fraction	% Ash	Solids	Fraction	% Ash
Units	g/m ² /month	g/m ² /month		g/m ² /month	g/m ² /month		g/m²/month	g/m²/month		g/m ² /month	g/m ² /month		g/m²/month	g/m²/month	
EPA Approved Level	4.0			4.0			4.0			4.0			4.0		
March 2021	0.7	0.4	57	1.0	0.5	50	0.7	0.3	43	0.7	0.4	57	1.2	0.7	58
February	0.3	0.2	67	0.4	0.2	50	0.4	0.2	50	0.5	0.3	60	0.4	0.4	100
March	0.6	0.2	33	0.5	0.2	40	0.8	0.2	25	0.5	0.2	40	0.9	0.5	56
April															
May															
June															
July															
August															
September															
October															
November															
December															
Annual Average	0.5	0.3	52.2	0.6	0.3	46.7	0.6	0.2	39.3	0.6	0.3	52.4	0.8	0.5	71.4
Annual Maximum	0.7	0.4	66.7	1.0	0.5	50.0	0.8	0.3	50.0	0.7	0.4	60.0	1.2	0.7	100.0
Annual Minimum	0.3	0.2	33.0	0.4	0.2	40.0	0.4	0.2	25.0	0.5	0.2	40.0	0.4	0.4	56.0

Particulate Matter (PM₁₀)

Sample Location: EPA 3 - Rodgers Road

Sample Frequency: 6 days

Date Sample Taken (24-hr)	Collected by	Date Results Received	PM ₁₀ μg/m³	Monthly Average Criteria (μg/m³)	Annual Average Criteria (µg/m ³⁾
4/03/2021	CBased - MB	15/03/2021	9	50	
10/03/2021	CBased - LK	19/03/2021	14	50	
16/03/2021	CBased - MB	25/03/2021	8	50	
22/03/2021	CBased - MB	30/03/2021	6	50	
28/03/2021	CBased - MB	1/04/2021	8	50	
Monthly Average			9		25/30*

^{*}Project Approval (PA 10_0183) outlines the annual average PM₁₀ criteria to be 30µg/m³. However, EPL 536 Condition R4.5a) requires that the air quality monitoring data is assessed against the Air Impact Assessment Criteria outlined in EPA's *Approved Methods for the Modelling and Assessment of Air Pollutants in NSW*. The most up to date version of this guideline was published in 2017 and outlines the annual average PM₁₀ criteria to be 25µg/m³. Metromix has considered both criteria for its review of particulate matter monitoring.

Comments

All PM ₁₀ results remained below the approved criteria for the sample period.

Particulate Matter (PM_{10}) - Year to Date

		Monthly Average	Year to Date Average	24-Hr Criteria	
Date	PM ₁₀ (μg/m³)	(µg/m³)	(µg/m³)	(µg/m³)	Comments
3/01/2021	10		10.0	50	
9/01/2021	5		7.5	50	
15/01/2021	37		17.3	50	
21/01/2021	18		17.5	50	
27/01/2021	20	18.0	18.0	50	
2/02/2021	11		16.8	50	
8/02/2021	6		15.2	50	
14/02/2021	12		14.8	50	
20/02/2021	7		14.0	50	
26/02/2021	14	10.0	14.0	50	
4/03/2021	9		13.5	50	
10/03/2021	14		13.6	50	
16/03/2021	8		13.1	50	
22/03/2021	6		12.6	50	
28/03/2021	8	9.0	12.3	50	

B411						
Minimum	5					
Maximum	37					
Average	12.32					
Standard Deviation	8.17					
24-hr Criteria	50					
Number of Exceedences	0					
Annual Average Criteria	25/30*					
Annual Average Criteria	No					
Exceeded						
*See explanation on previous page.						

Water

Water Monitoring

EPL Point 4 - Monthly Monitoring

					рН	EC	TSS	Oil & Grease	Comments
				Units	pH Units	μS/cm	mg/L	mg/L	
			Date Results	EPL Criterion*	6.5-8.5	NA	<50	10	
Date	Time	Sampled By	Received	ANZECC Water Quality Limits	6.5-8.5	125-2200	<50	-	
1/03/2021	11:30am	Metromix - GS	8/03/2021		7.16	1800	8	6	-

EPL Point 5 - Monitoring Once During Commencement of Discharge

						pН	EC	TSS	Oil & Grease	Comments
					Units	pH Units	μS/cm	mg/L	mg/L	
				Date Results	EPL Criterion*	6.5-8.5	NA	<50	10	
Dat	te	Time	Sampled By	Received	ANZECC Water Quality Limits	6.5-8.5	125-2200	<50		

No monitoring was required at this location in March 2021.

EPL Point 6 - Monthly Monitoring

					pН	EC	TSS	Oil & Grease	Comments
				Units	pH Units	μS/cm	mg/L	mg/L	
			Date Results	EPL Criterion*	6.5-8.5	NA	<50	10	
Date	Time	Sampled By	Received	ANZECC Water Quality Limits	6.5-8.5	125-2200	<50	•	
No discharge	e occurred at th	nis location and the	refore no monitori	ng was required					

EPL Point 7 - Monthly Monitoring


					pН	EC	TSS	Oil & Grease	Comments						
				Units	pH Units	μS/cm	mg/L	mg/L							
			Date Results	EPL Criterion*	6.5-8.5	NA	<50	10							
Date	Time	Sampled By	Received	ANZECC Water Quality Limits	6.5-8.5	125-2200	<50	-							
No discharge	e occurred at th	is location and the	refore no monitorii	No discharge occurred at this location and therefore no monitoring was required											

Flow Meter Records

EPA Identified Point	Location	Description	Sample Period	Daily Average Flow ML	Monthly Total Flow ML
4	Adit Dam	Adit Dam to Creek (off site)	1/03/2021 to 1/04/2021	8.75	271.13
5	Dam B	Discharge from Dam B (from Quarry)	1/03/2021 to 1/04/2021	N/A	28.3
4	Adit Dam	Water pumped from Adit Dam to Dam G (processing use)	1/03/2021 to 1/04/2021	N/A	88.50

Comments

All water monitoring results remained within the approved criteria levels during the monitoring period.

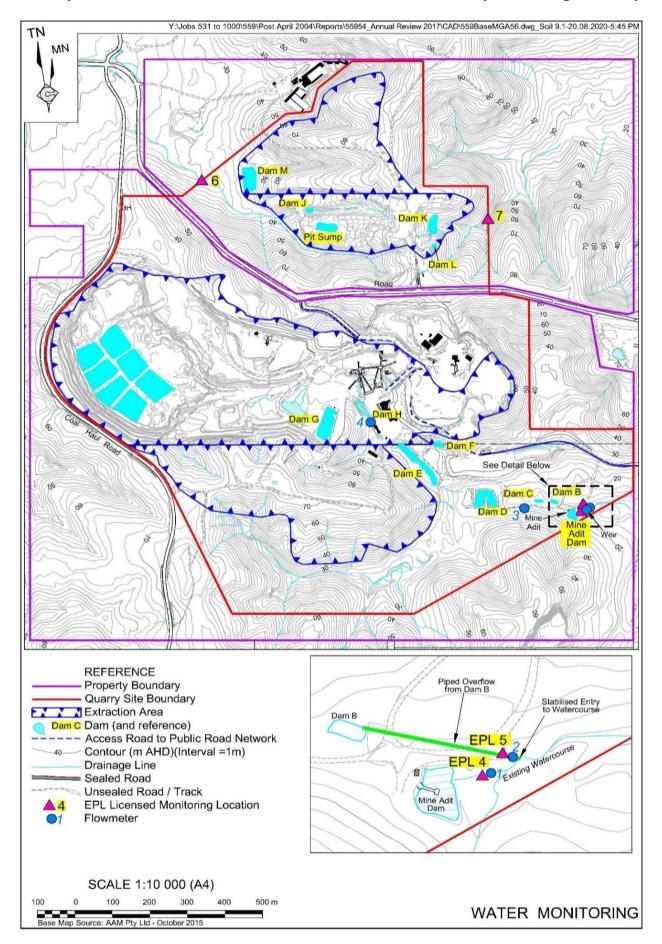

Water - Year to Date

EPL Point 4: Monthly Monitoring

	pH	EC	TSS	Oil & Grease	Comments
Units	pH Units	μS/cm	mg/L	mg/L	-
EPL Criterion*	6.5-8.5	NA	<50	10	-
March 2021	6.5-8.5	125-2200	<50	<5	-
January	7.18	1890	6	<5	-
February	7.11	1880	<5	<5	-
March	7.16	1800	8	6	-
April					
May					
June					
July					
August					
September					
October					
November					
December					

EPL Point 5: Monitoring During Discharge

	рН	EC	TSS	Oil & Grease	Comments
Units	pH Units	μS/cm	mg/L	mg/L	-
EPL Criterion*	6.5-8.5	NA	<50	10	-
ANZECC Water	6.5-8.5	125-2200	<50	-	-
Quality Limits					
4/01/2021	7.24	862	6	<5	-
1/02/2021	7.40	921	<5	<5	-
11/02/2021	7.32	1140	<5	<5	-

Flow Meter Records

EPA Identifier	Location	Description	Date	Monthly Total
4	Adit Dam	Water pumped from Adit Dam to Dam G	4/01/2021	80.9
		(processing use)	1/02/2021	94.8
		,	1/03/2021	88.50

EPA Identified	Location	Description	Date	Monthly Total
5	Dam B	Discharge from Dam B (from Quarry)	4/01/2021	0.0
		, , , , , , , , , , , , , , , , , , , ,	1/02/2021	0.0
			1/03/2021	28.3

EPA Identified	Location	Description	Date	Monthly Total
4	Adit Dam	Adit Dam to Creek (off site)	4/01/2021	33.5
			1/02/2021	94.9
			1/03/2021	271.13


Meteorological Conditions

Monitoring Location: Mid-Pit Entrance
Monitoring Frequency: Continuous

Windrose

Metromix Teralba - Windrose

00:00 1 March 2021 to 23:55, 31 March 2021

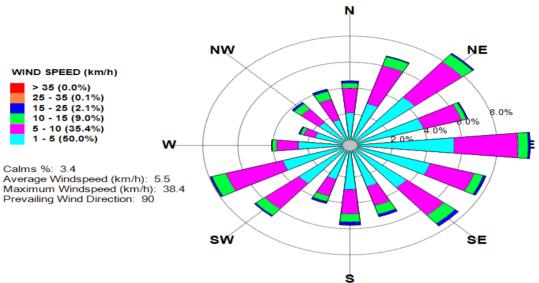

Monthly Summary

Date	Mean Wind Direction (°)	Mean Wind Speed (km/h)	Daily Rainfall (mm)	Mean Sigma Theta	Max Temperature (°C) at 2m	Min Temperature (°C) at 2m
01/03/21	168	5.3	0.0	31.6	33.2	21.4
02/03/21	176	7.0	0.0	37.2	26.8	19.6
03/03/21	166	4.4	8.2	38.3	23.8	16.8
04/03/21	175	5.0	2.2	27.0	28.0	15.0
05/03/21	190	6.1	0.0	35.0	24.8	17.6
06/03/21	176	5.2	0.0	36.9	24.6	16.2
07/03/21	143	4.2	0.0	26.4	26.6	16.0
08/03/21	161	6.0	1.6	23.9	32.0	18.0
09/03/21	208	6.5	7.2	42.0	31.8	20.4
10/03/21	122	3.7	0.2	33.9	25.8	20.0
11/03/21	63	5.2	0.0	28.2	27.8	19.6
12/03/21	77	4.5	0.0	23.8	26.0	20.4
13/03/21	131	5.5	0.0	23.7	32.8	18.6
14/03/21	167	7.7	48.8	32.5	24.9	14.2
15/03/21	181	6.9	0.2	34.4	23.0	14.2
16/03/21	174	3.2	6.2	38.5	22.6	15.0
17/03/21	113	6.4	0.6	33.0	23.2	17.0
18/03/21	139	6.1	90.4	36.5	20.2	17.6
19/03/21	119	6.6	28.4	33.2	21.5	18.4
21/03/21	105	6.1	47.8	31.4	21.6	18.4
21/03/21	79	7.7	65.0	30.6	19.8	16.8
22/03/21	79	4.0	22.8	29.2	19.6	16.7
23/03/21	71	6.1	21.8	25.6	21.2	17.6
24/03/21	257	8.3	0.2	40.1	28.4	18.4
25/03/21	241	6.9	0.0	34.7	29.0	17.1
26/03/21	211	5.1	0.0	25.3	25.6	16.2
27/03/21	200	4.6	0.0	26.1	28.2	15.6
28/03/21	175	3.6	0.0	31.3	26.2	14.4
29/03/21	182	3.0	0.0	32.9	24.8	16.4
30/03/21	212	6.1	9.4	35.4	22.8	14.7
31/03/21	217	5.4	1.8	31.0	23.8	13.8

Meteorological Conditions - Year to Date

Monitored Parameter	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Total Rainfall (mm)	130.0	135.0	362.8										
Average Minimum Temperature (°C) at 2m	18.1	18.2	17.2										
Average Maximum Temperature (°C) at 2m	28.6	26.4	25.5										
Average Minimum Temperature (°C) at 10m	18.5	18.5	17.5										
Average Maximum Temperature (°C) at 10m	27.3	25.4	24.7										
Average Sigma Theta	30.9	32.2	31.9										
Average Solar Radiation (W/m²)	214.6	183.9	137.7										
Average Relative Humidity (%)	71.7	77.0	75.0										

Blasting

Monitoring Frequency: Blast Monitoring Completed By:

Each Blast Orica (Blast 1 to 12) MAXAM (Blast 13)

					Locatio	n 1	Locatio	n 2	Locatio	n 3	Comments
Shot #	Day	Month	Time	Location	Overpressue	Vibration	Overpressue	Vibration	Overpressue	Vibration	
					dB(L)	mm/s	dB(L)	mm/s	dB(L)	mm/s	
1	22	January	11:52:04	Stage 2A	101.7	0.2	NT	NT	NM	NM	The trigger parameters for the blast monitors were reduced to 100dBL and 0.13mm/s to assist in obtaining a reading. An additional monitor was placed halfway between Blast monitor 1 (McEwen St) and the blast. This monitor recorded 111.7dBL overpressure and 0.35mm/s vibration.
2	11	February	14:50:06	Stage 2A	105.6	0.37	102.3	0.08	NM	NM	
3	17	February	12:50:00	Stage 2A	109.7	1.43	NT	NT	NM	NM	
4	11	March	13:42:00	Stage 2A	101.5	0.24	NT	NT	NM	NM	The trigger parameters for the blast monitors were set to 100dBL and 0.13mm/s to assist in obtaining a reading. An additional monitor was placed halfway between Blast monitor 1 (McEwen St) and the blast. This monitor recorded 110.6dBL overpressure and 0.55mm/s vibration. The Rhondda Road monitor was tested prior to blasting and recorded readings of 102.2dBl(via clapping) and 7.31mm/s (via stomping).

NT Not Triggered NM Not Monitored

Blasting Criteria

		Lir	nit
Parameter	Units of Measure	95% of blasts per year	100% of blasts
Airblast Overpressure (Linear Peak)	decibels (dBL)	115	120
Ground Vibration (Peak Particle Velocity)	millimeters per second	5	10

Comments
One blasting event occurred during the monitoring period. All blast monitoring results were within the approved criteria.

Waste Management

Waste Removal Summary

Month	January	February	March	April	May	June	July	August	September	October	November	December
Items	Quantity	Quantity	Quantity	Quantity								
General Waste Bin (10m3)												
General Waste Bin (4.5m ³)												
General Waste Bin (6m3)												
General Waste Bin (20m³)	1											
Paper & Cardboard Bin (3m ³)	1	1										
Shredded Paper Bin (240L)												
Co Mingled Recycling (2 x 240 L)	4	4	6									
Tonner Cartridges												
Waste Oil (L)			1800									
Scrap Steel (t)												
Timber (m ³)												
Engine Coolant (L)												
Oil Filters (240L bin)		3	1									
Batteries			15									
Oily Rags (240L bin)												
Aerosols (120L bin)												
Tyres												
Other												
Oily Water (L)												
Grease Waste (L)												